



# Car Seat Recalls/Defects & Safety Notices - Revised 7/24/2009

This list, covers child car seats manufactured after 12/31/99, was compiled by the Safety Restraint Coalition (425) 828-8975 or 1-800-282-5587 (WA State only). For older seats see separate Archive List (revised yearly.) Information may change, always call manufacturer to verify. **Most recent addition(s) are shaded.**

## Angel Guard (No Recalls)

c/o Mercury Distributing,  
7001 Wooster Pike, Medina, OH 44256  
800-815-6330 x120,  
www.angel-guard.com

## Baby Trend Inc.

1607 S Campus Ave, Ontario, CA 91761,  
800-328-7363, www.babytrend.com

### Infant Seats

**Rigid Latch-Loc models 6439, 6448, 6481, & stand alone base 6400** made 5/14/07-4/1/08. LATCH connector metal parts (pawls) can crack allowing connectors on base to release from vehicle anchors in severe crash. **Call:** 800-328-7363 for replacement Flex-Loc Base in exchange for Rigid Latch-Loc Base. Until replaced secure base or seat alone w/ vehicle belt.

## Basic Comfort

455 Lincoln Street, Denver, CO 80203  
800-456-8687, www.basiccomfort.com

## Bergerson Health Care

15 S Second Street, Dolgeville, NY  
13329, 800-371-2778  
www.adaptivemall.com (No Recalls)

## Britax

13501 S Ridge Dr Charlotte, NC 28273,  
888-427-4829, www.britaxusa.com

### Infant Seats

**Companion Problem #1: All Models** made pre-11/1/07. Clarification campaign to update users guide; clarify height; & inner buckle strap position. Use inner buckle position for infants under 11 lbs. Once child reaches 11 lbs. move to outer position for remainder of use with that child. Child exceeds height requirement when top of head is less than 1 inch from top of seat or height exceeds 30 inches. **Call:** 888-427-4829 for instructions & labels. **Problem #2: Model E9L14** made 10/31/03-6/6/04. Tabs on bottom of carrier may not be properly seated. If not properly seated carrier may rotate too far in crash increasing risk of injury. **Call:** 888-427-4829 for inspection instructions. If unit is affected, use carrier without base until replaced.

### Convertible Seats

**Decathlon Model E9L47** made 2/12/05-7/31/07. **Problem:** When adjuster strap is pulled from an extreme side angle, push button housing may separate from shell. Allowing adjuster to move out of position so harness may become difficult to tighten properly. **Call:** 800-683-2045 or visit www.decath-

lonrecall.com or to request push rivet fasteners to secure adjuster to housing.

**Boulevard Model E9L57** made 3/1/06-8/1/06. **Problem:** In crash, tether hook may open/break & release when used forward facing for child over 50 lbs. If tether breaks, seat may move from upright to reclined position increasing risk of injury. Do not use tether for child over 50 lbs. **Call:** 888-427-4829 for new manual & labels.

**Marathon Problem #1: Model E9L06, E9W06 & E906** made 5/23/06-7/28/06. Only seats with lot number "KGR 01 A" stamped on tether hook are affected. Tether hook may open & release, when used for a child weighing more than 50 lbs, allowing child to move too far forward. Discontinue use of tether for child over 50 lbs until replacement is installed. Note: Tether should only be used beyond 50 lbs if vehicle manufacturer allows tethering above this weight. **Call:** 800-683-2045 or visit www.marathonrecall.com for tether hook & "DO NOT USE" label. **Problem #2: Model E9L06** made pre-7/24/04. Adjustment strap may slip & allow harness to loosen. **Call:** 888-427-4829 for new strap. Until replaced, check slippage by pulling on harness without lifting release lever. If harness loosens do not use seat until fixed.

**Wizard Model E9L07** made pre-7/24/04. **Problem:** Adjustment strap may slip & allow harness to loosen. **Call:** 888-427-4829 for new strap. Until replaced, check slippage by pulling on harness without lifting release lever. If harness loosens do not use seat until fixed.

**Advantage model E9022** made 3/5/01-7/26/01. **Problem:** Tether bracket may separate from seat in crash. **Destroy!**

### Forward Facing Only Seats

**Regent Problem #1: Advisory model beginning E9L39** made pre-6/18/07. Seat & instructions have been modified to enhance performance. **Call:** 888-427-4829 for instructions, label, longer LATCH strap & slip-resistant strips. Use long belt path for 22-40 lbs. & short path for 40-80 lbs. Recline bar required for ALL installations. **Problem #2:** Recall model E9L3998 made 12/18/06-1/18/07 with Classic fabric. Incorrect warning label on cover. **Call:** 888-427-4829 for new pad.

**Super Elite Problem #1: Model E9031** all dates. Harness adjuster may stick causing webbing to slip & harness to loosen. **Call:** 888-427-4829 for adjuster strap guide. Until repaired check harness is secure before use. **Problem #2: Model E9031** made 4/25/01-2/15/02. Too much forward head movement in crash without HUGS harness system. **Call:** 888-427-4829 for replacement harness/comfort pads.

**Husky Problem #1: Model E9L30** made pre-7/24/04. Adjustment strap may slip & allow harness to loosen. **Call:** 888-427-4829 for new strap. Until replaced, check slippage by pulling harness without lifting release lever. If harness loosens do not use seat until fixed. **Problem #2: All models & manufacture dates.** Use of long (serpentine) belt path w/ lap only belt allows too much forward head movement. **Call:** 888-427-4829 for new labels & instructions.

**Traveler Plus Model E9L32** made pre-7/24/04. **Problem:** Adjustment strap may slip & allow harness to loosen. **Call:** 888-427-4829 for new strap. Until replaced, check slippage by pulling on harness without lifting release lever. If harness loosens do not use seat until fixed.

### Combination Seats

**Frontier Model E9L54E7, E9L54H6, E9L54H7, & E9L54M6** (black harness) made 4/1/08-9/14/08, & **E9L5490** (beige harness) made 4/1/08-9/17/08. **Problem:** When loosening harness by pulling on only one strap, straps may become detached from harness yoke (splitter plate) on back of seat causing child to be improperly restrained. **Call:** 800-683-2045 for repair kit containing plastic covers for harness yoke ends. Parent is instructed to always pull on both straps when loosening harness.

## Car Seat Specialty (See Team-Tex)

## C.E. White (No Recalls)

PO Box 308, New Washington, OH  
44854, 419-492-2157

## Chicco

1826 William Penn Way  
Lancaster, PA 17601  
877-424-4226, www.chiccousa.com

### Infant Seats

**KeyFit & KeyFit 30 Bases Only** All models made 2/26/08-3/17/08. **Problem:** Some bases have defect in LATCH attachments. When installed with LATCH webbing used to tighten seat can slip & loosen. **NOTE:** Until repaired install only with vehicle seat belt. **Call:** 800-807-8817 to report defective base and receive envelope. Owner will then cut off LATCH connectors and send in with personal information and will receive new base.

## Columbia Medical (No Recalls)

13577 Larwin Circle, Santa Fe Springs, CA  
90670, 800-454-6612,  
www.columbiamedical.com

## Combi USA, Inc.

1962 Highway 160 West, Ste 100, Fort  
Mill, SC 29708, 800-992-6624,  
www.combi-intl.com

### Infant Seats

**Centre & Centre ARB Model** 8065, 8074, 8086, 8087 & 8520 made 10/2005-12/2007. **Problem:** Seat may separate from base in frontal crash. **Call:** 800-543-7734 for retrofit kit. Until installed, use only without base.

**Shuttle Model 4400, 4515, & 4520** made 10/2005-12/2007. **Problem:** Seat may separate from base in frontal crash. **Call:** 800-543-7734 for retrofit kit. Until installed, use only without base.

### Convertible Seats

**Avatar Model 8100** made 11/03-5/04. **Problem:** Lower LATCH belt does not meet standards. In crash seat may detach from lower anchorage resulting in serious injury. **Call:** 800-992-6624 until kit is installed, do NOT use LATCH to install use vehicle seat belt instead.

## Compass (See Learning Curve)

## Dorel Juvenile Group (Cosco/Maxi-Cosi/ Safety 1st/Quinny/Eddie Bauer)

2525 State Street, Columbia, IN 47201  
800-544-1108, www.djgusa.com

### Car Beds

**Dream Ride Ultra Model 22-001FSM** made 12/01/03-4/28/04. **Problem:** Failed testing when used rear-facing. Use only as car-bed. **Call:** 866-611-3022 for warning label. If child needs rear-facing seat, Dorel will replace.

### Infant Seats

**Mico Models 22-371, 22-372, & Separate Base 22-515** made 7/1/07-2/17/08. **Problem:** Carrier may not attach properly to base. If carrier is not properly attached child could be injured in crash. **Call:** 877-657-9546 or visit safety notices at www.djgusa.com for a free replacement base.

**Comfort Problem #1: Models beginning "22" 331 BLA, 332 RLA, 631 LNG, 630 AFD, 630 BAL, 630 FTM, 630 HPN, 630 LRS, & 630 LKM** made 7/26/05-2/28/06. Handle trim screws can loosen presenting choking hazard. **Call:** 877-229-1374 or e-mail comfortinfant@djgusa.com for repair kit. OR **Problem #2: Models beginning "22" 331, 332, 630, & 631.** Some consumers experience difficulty installing the original base. **Call:** 877-229-1374 for replacement base under this Customer Satisfaction Program or visit <http://comfortinfant.djgusa.com>.

**Designer 22 Problem #1: Models all begin "22" & end "GB1B" these models 625 AFD, 625 GLC, 625 EDG, 625 MAC, 325 CMB, 325 VIN, 325 DTA, 325 TST, & 300 JOS** made 8/19/03-10/20/04. If harness isn't properly tightened, webbing may slip, in crash child could move too far forward increasing risk of injury. **Call:** 800-881-

0570 for kit consisting of two clips & instructions. **Problem #2: Models 02-621-SAL, 02-620-AZY, & 02-620-BEA** made 1/3/02-2/13/02. Handle releases suddenly when carried seat may flip & child may fall. **Call:** 800-536-1090 for handle repair. Until installed, do not use as carrier.

**Turnabout & Arriva Models begin "02"** 665, 727, 728, 729, 731, 732, 733, 750, 751, 755, 757, 774, 753, 756, 758, 759, 760, 761, 762, 763, 764, 765, 770, 771, & 772 made pre-1/31/00. **Problem:** Handle releases suddenly when carried seat may flip & child may fall. **Destroy!**

### Convertible Seats

**Touriva 5-pt. Models 22-100 TTD, 22-100 FSM, 22-100 TIP, 22-111 FSM, 22-130 WAL, 93-100 FSM, & 93-111 FSM.** **Problem:** Made 9/28/04-9/20/07. Elastic straps securing pad to seat shell may come loose allowing child to loop straps around body. **Call:** 888-698-6681 for repair kit.

**Regal Ride Model 22-139 MON.**

**Problem:** Made 9/28/04-9/20/07. Elastic straps securing fabric pad to seat shell may come loose allowing child to loop strap around body. **Call:** 888-698-6681 for repair kit.

**Alpha Omega & Eddie Bauer 3-in-1 Problem #1: Models 22-150, 22-151, & 22-770.** Made 10/1/05-12/31/05. Child's fingers may get caught in hole in edge of armrest shell. **Call:** 877-639-0659 for repair of voluntary safety notice. **Problem #2: Models 02-331, 02-332, 02-531, 02-533, 02-537, & 02-555.** Made 11/17/00-1/10/01. Tether webbing may be cut & separate in crash increasing risk of injury. **Destroy!**

**Alpha Omega, Alpha Omega Elite, 3-in-1, Deluxe 3-in-1, Deluxe Convertible, Alpha Elite, Intera & Ensira Models 22150, 22155, 22180, 22269, 22740, 22750, 22755, 22756, 22757, 22770, 22151, 22450, 22451, 22452, 22453, 22455, 22460, 22480, & 22481** made 11/03-12/05. **Problem:** Harness adjuster may slip increasing risk of injury in crash. Check for slippage: tighten harness, pull harness straps without pressing/lifting adjustment lever. If movement occurs, use different seat until fixed! **Call:** 800-219-0509 for kit.

### Booster Seats

**High Rise Model 22-297, 22-298, & 22-299.** Made 10/1/03-10/31/03. **Problem:** Warning label on side of seat states restraint is for use by children UNDER 1 year. **Call:** 866-611-3022 for new sticker stating seat is for use by children OVER 1 year.

### Downunder

(Out of Business) (No Recalls)

### Evenflo Company Inc.

1801 Commerce Drive, Piqua, OH 45356, 800-543-8954 www.evenflo.com

### Infant Seats

**Discovery Problem #1: Model 3021769Z & 3021854Z.** Made 2/4/08. (Note: All sold at Target & Wal-Mart Stores.) Seat may have shipped without complete assembly of red release handle. Under certain conditions, this

may cause seat to separate from base resulting in serious injury. **Call:** 800-233-5921 for replacement seat & base. Until replaced install seat only without base. **Problem #2: Models beginning 390, 391, 534, & 552.** Made 4/1/05-1/31/08. Seat could separate from base in high impact side crash. **Call:** 800-356-2229 or visit www.evenflo.com/discovery for supplemental dual hook fastener.

**Embrace Models beginning 317, 320, 397, 398, 540, 548, 549, 550, 556, 597, 598, & 599.** Made pre-4/8/06. **Problem:** Handle releases unexpectedly when carried may allow seat to flip & child to fall. **Call:** 800-490-7497 for repair kit. Do not use as carrier until installed.

**All Cozy Carry bases. Problem:** Performance of base may be improved in certain crashes. **Call:** 800-233-5921 for upgrade kit.

**All Seats w/ Position Right Bases. Problem:** ALL models Made pre-2/10/00. Posts may bend making seat difficult to attach to base. **Call:** 800-233-5921 for kit.

### Convertible Seats

**Tribute & Tribute 5 Models begin 378 or 379** made 9/8/05-9/22/05. **Problem:** Shell may crack in some types of crashes. **Call:** 800-233-5921 for replacement.

**Triumph Problem #1:** model 264 made 10/20/01-1/31/02. The slide loop connectors holding harness may not be strong enough to properly restrain child. **Call:** 800-233-5921 for safety upgrade kit. **Problem #2:** model 264, 359, & 389 made 9/6/01-10/31/05. Child may pull back cloth cover accessing foam liner becoming choking hazard. **Call:** 800-490-7591 or www.triumphcarseat.com for protective sleeve upgrade kit.

### E-Z-On Products (No Recalls)

605 Commerce Way West, Jupiter, FL 33458, 800-323-6598, www.ezonpro.com

### Fisher Price

(See Britax)

### Graco

150 Oaklands Blvd Exton, PA 19341 800-345-4109, www.gracobaby.com

### Infant Seats

**Graco SnugRide Problem #1: Models 8609FOF2, 8609FOF3, 8616FOF2, 8616FOF3, 8643DDH2, 8643DDH3, 8643CDR2, 8643DH03, 8643SUP2, 8643SUP3, 8643JOS2, 8643JOS3, 8643MDW3, 8643PWC3, 8643SFJ3, 8645FMT2, 8645FMT3, 8645GLM3, 8645GLN3, 8645HEM2, 8645HEM3, 8645MYC2, 8646SML3, 8645MYC3, 8645MRG3, 8645PKR2, 8645SNY2, 8646SND2, 8645THR2, 8645THR3, 8646FIE2, 8646FIE3, 8646GRT3, 8646RRY3** made 8/1/06-6/30/07. On some seats, backing on seat pad may pull away from seams allowing child to reach filling & creating choking hazard. **Call:** 800-345-4109 for replacement seat pad. **Problem #2: Models 82L02, 8402L03, 8442BLW, 8442BRN, 8442CYP, 8442GMP, 8442LBLW, 8442LCYP, 8442LMAD, 8442LMECA, 8442MAD,**

**8442YL, 8444HAB, 8444LHAB, 8444LHAB-CA, 8444LHIC, 8444LKER, 8444LKER-CA, 8444PLT, 8444MEL, 8446LFKB, 8446LVIN, 8446VIN, 8447JAM, 8447LHAV, 8447LHAV, 8447LJAM, 8447LLAG, 8447LNGS, 8447LNGSCA, 8447NGS, 8448LDIA, 8448LDIACA, 8448LSAR, 8457DVB, 8458FKB, 8459VL, 8463AMB, 8463GMP, 8463GMPCA, 8463JJCA, 8463JUN, 8463MAN, 8463YL, 8464MAC, 8464MACCA, 8464MEL, 8464MIC, 8464MLL, 8470BUG, 8471UVB, 8478SAR, 8601FOF, & C844342** made 3/1/02-3/8/03. Hardware may be missing to attach carrier to base. If missing carrier may not securely attach causing injury in crash. **Call:** 800-345-4109. Until repaired do NOT use base. **Problem #3: models 7493G9, 7493RS, 7497HL, 7497SY, 7499LK, 7499N2, 8411O1, 8411O2, 8411O3, 8412O3, 8412T02, 8457D5, 8457DVB, 8457F3, 8457GP, 8457IND, 8457MA, 8457MV, 8457RC, 8457TJM, 8457TMP, 8457YL, 8458A5, 8458AE, 8458B7, 8458D8, 8458FKB, 8458HE, 8458HH, 8458KY, 8458N5, 8459VL, 8460LV, 8462HAV, 8462JAM, 8471UVB, 8472BLW, 8472BRN, 8472CYP, 8472GMP, 8472MAD, 8472YL, 8474HAB, 8474MEL, 8476VIN, 8477HAV, 8477JAM, 8477NGS, & 8478SAR** made 8/31/99-2/28/02. Seat may be missing metal hooks or "U" bars attaching carrier to base. If missing, carrier may not securely attach causing injury in crash. **Destroy! Problem #4: models 840302, 8402L03, 840301, 840303, 8442GMP, 8442LBLW, 8442LCYP, 8442LMAD, 8444LHAB, 8444LHIC, 84463AMB, 8446LVIN, 8447LHAV, 8448LSAR, 8463GMP, 8463JUN, 8463YL, 8464MAC, 8464MEL, 8602AMB, 8602JUN, 8602MA, 8603MLL, 8605HIG, 8605KER, 8605PLT, 8607LAG, 8607NGS, 8608DIA, & 8609FOF** made 3/7/03-3/8/03. Seat may be missing metal hooks or "U" bars attaching carrier to base. If missing, carrier may not securely attach causing injury in crash. **Call:** 800-345-4109 until repaired do NOT use base.

### Convertible Seats

**Graco ComfortSport Problem #1: Models 8C04FRR & 8C04FRR2.** Made 11/1/2006-10/08/2007. Seat has large "body pillow" that partially covers airbag warning label. **Call:** 800-345-4109 Graco will instruct consumer to discard body pillow which is for comfort only & does not affect safety of seat. **Problem #2: Models 8629WTL, 8630MTR, 8631DFT, 8631DRA, 8632PSO, 8635TAC, 8639COS, 8C00BLG, 8C00DMN, 8C00GRP, 8C00LNW, 8C00MID, 8C00TMB, 8C01SVD, 8C01WTN, 8C02MGI, 8C02MRC, 8C03HAL, 8C03WCF, 8C04FRR, & 8433FOF.** Made 5/2/07-7/31/07. Some seats may have Lower Anchor belt misrouted causing seat to exceed safe angle in crash. Do NOT use LATCH to install seat rear-facing until repaired! Instead use seat belt. **Call:** 800-345-4109 for instructions.

**SmartMove Models 44709MTE & 44709SVR** made 4/9/01-5/10/01. **Problem:** When used forward-facing harness adjustment mechanism allows webbing to slip. Child may not be properly restrained. **Destroy!**

**Encore models 44612GTN &**

**4662WSC01** made 4/9/01-5/10/01.

**Problem:** When used forward-facing harness adjuster allows webbing to slip. Child may not be properly restrained. **Destroy!**

**Bravo models 44622LTG, 44630LTH, 44631PFN, & 44662WSC** made 4/9/01-5/10/01. **Problem:** When used forward-facing harness adjuster allows webbing to slip. Child may not be properly restrained. **Destroy!**

**Accel models 45100CHT, 45100MTE, 45100STH, 45200MXM, 45600JTI, 45600MTE, 45600MTO, 45600MXM, 45600SAF, 45700GSD, & 45700LFT** made 4/9/01-5/10/01. **Problem:** When used forward-facing, harness adjuster allows webbing to slip. Child may not be properly restrained. **Destroy!**

### Combination Seats

**CarGo, Platinum CarGo, Treasure CarGo, & Ultra CarGo** models 8487BEL, 8487SMP, 8487WBR, 8686ROS, 8689FAR, 8D01ZPH, 8D02SYC, 8D03WIK, 8D04SDN, 8D05NWX, 8D10CCE made 1/9/2007-3/3/2008. **Problem:** NHTSA Hotline phone number on label affixed to seat back may be incorrect. Should read 888-327-4236. **Call:** 800-345-4109 for sticker kit.

### Harmony Juvenile Products

1600 53rd Street  
North Bergen, NJ 07047, 877-306-1001  
www.harmonyjuvenile.com

### Immi (No Recalls)

18881 US 31 North  
Westfield, IN 46074, 317-896-9531

### Jane (No Recalls)

PO Box 410007, San Francisco, CA 94141, 866-355-2630

### LaRoche Brothers, Inc.

(No longer makes car seats) (No Recalls)  
PO Box 95, Gardner, MA 01440,  
978-632-8638

### Learning Curve

1111 West 22nd St, Ste. 320,  
Oak Brook, IL 60523, 800-704-8697,  
www.learningcurve.com

### Infant Seats

**I420 Model I420 ARD, I420 FUO, & I420 MAR** made 5/7/06-5/15/06. **Problem:** Crotch anchor on seat bottom was installed incorrectly. In a crash, it may become dislodged allowing child to move & increasing risk of serious injury. **Call:** 888-899-2229 for repair kit & instructions.

### Lenox Juvenile Group

(No Recalls) (Out of business)  
100 SW 52nd Ave, Ocala, FL 34474,  
888-372-0622, www.smartchildseat.com

### Magna Aftermarket of America, Inc. (No Recalls)

600 Wilshire Drive, Troy, MI 48084  
866-656-2462, www.magnacleck.com

## Maxi-Cosi (See Dorel Juvenile Group)

## Mercedes Benz USA

(Child Seats manufactured by Britax)

### Forward Facing Only Seats

**Top Safe Child Seat** made 3/1/03-11/30/03. **Problem:** Lower LATCH attachment may detach in crash causing injury. **Call:** Dealer for refund recall campaign #2004 120005. Use seat belt to secure seat.

## Merritt Manufacturing

PO Box 17152, Indianapolis, IN 46271, 317-409-0148, www.eztether.com

## Mia Moda, Inc.

1 Meridian Blvd, Wyomissing, PA, 19610, 866-MIA-MODA  
www.miamodainc.com

### Infant Seats

**Viva Model 5000 & 5001** made 12/19/06-2/6/07. **Problem:** Lower LATCH attachment may interfere w/ connection of carrier/base after tightening anchors. Audible click may still be heard indicating secure connection. Pulling up on carrier handle may also indicate secure connection. In severe crash carrier may detach causing injury. Also, required registration card was not provided w/ seats or separate bases. Note: Until repaired install using vehicle seat belt. **Call:** 866-642-6632 for lower anchor assembly & serial number labels.

## Nania (See Team-Tex)

## Orbit Baby

5437 Central Ave., Ste 10, Newark, CA 94560, 877-ORB-BABY, www.orbitbaby.com

### Infant Seat

**All Orbit Baby Bases** made pre-2/2008 **Problem:** Base must be upgraded for use w/ Toddler Car Seat. **Call:** 877-ORB-BABY or visit www.orbitbaby.com. To receive new base w/ green circular seal, Toddler seat & Base must both be registered.

## Peg-Pérego

3625 Independence Dr, Fort Wayne, IN 46808, 800-671-1701, www.pegperego.com

### Infant Seats

**Primo Viaggio SIP 30/30 Models** beginning "IMUNOOUS" 32MD41KN41, 35CR13BU13, 35CR13PL46, 35CR-24BU24, 35TL49KN53, 35TL53KN46, 61ST13IC53, 61ST34IC53, & 61ST48IC53 made 7/1/07-3/14/08. Plastic harness adjuster cover may have sharp edge that can cause cuts or scratches to bare legged infants. **Call:** 888-734-6030 for new adjuster cover.

**All Primo Viaggio Seats/Travel Systems Problem #1:** Seats w/ dark button in red circle made 5/20/01-2/15/02. Snap & fabric interfere w/ harness preventing seat from latching. **Call:** 877-737-3468 for instructions. Do

not use until repaired! **Problem #2:** made 2/1/01-6/10/01. Left latch may not lock seat into base causing injury/death in crash. **Call:** 877-737-3468 for instructions.

## ProRider (No Recalls)

7818 S 212th Street #106, Kent, WA 98032, 800-642-3123, www.prorider.com

## Quinny (See Dorel)

## Recaro

3275 Lapeer Road W, Auburn Hills, MI 48326, 800-873-2276 www.recaro.com

### Convertible Seats

**Como Problem #1: All models** made 11/1/07-2/16/09. Harness may not tighten/lock properly. In crash child may not be securely restrained & sustain injury. **Inspect seat:** Take empty seat & pull on harness adjuster strap to fully tighten harness. Next, pull on both shoulder straps without lifting/pressing harness release lever. If straps loosen, immediately stop using seat & call: 888-473-2290 for replacement. If harness straps stay tight continue using seat. **Problem #2: All models** made pre-12/18/07. Harness can disconnect from harness connector (splitter plate) as child is taken in/out of seat. In crash, unsecured child can be injured. **Call:** 800-873-2276 for rubber caps to close gap allowing harness to disconnect. **Problem #3: all models** made pre-9/17/07. Forward-facing shoulder belt guide (previously called lock-off) may not prevent some older style (ELR) seat belts from loosening. **Call:** 800-873-2276 for locking clip in this consumer advisory campaign.

**Signo Problem #1: All models** made 11/1/07-2/16/09. Harness may not tighten/lock properly. In crash child may not be securely restrained & sustain injury. **Inspect seat:** Take empty seat & pull on harness adjuster strap to fully tighten harness. Next, pull on both shoulder straps without lifting/pressing harness release lever. If straps loosen, immediately stop using seat & call: 888-473-2290 for replacement. If harness straps stay tight continue using seat. **Problem #2: All models** made pre-12/18/07. Harness can disconnect from harness connector (splitter plate) as child is taken in/out of seat. In crash, unsecured child can be injured. **Call:** 800-873-2276 for rubber caps to close gap allowing harness to disconnect.

## Safe Traffic System Inc. (No Recalls)

3343 W Eastwood Ave, Chicago, IL 60625, 847-329-8111, www.safetrafficsystem.com

## Safeline Kids (See Tripleplay)

## Safety Angel/Safe Start

PO Box 740151 (No Recalls)

Boynton Beach, FL 33474, 888-743-3798, www.safetyangel.com

## Safety Baby (see Combi)

## Safety First (See Dorel)

## Sammons Preston Rolyan

1000 Remington Blvd (No Recalls) Bolingbrook, IL 60440, 800-323-5547, www.tumbleforms.com

## Snug Seat

PO Box 1739, Matthews, NC, 28106, 800-336-7684

### Special Needs

**Gorilla 200-1000** made 6/26/02-1/15/03. **Problem:** Washer on tether may rust. In crash, tether may break causing injury. **Call:** 800-336-7864 for new washer.

**Spelcast 600-1000** made 6/26/02-1/15/03. **Problem:** Washer on tether may rust. In crash, tether may break causing injury. **Call:** 800-336-7864 for new washer.

### Travler Plus See Britax

## Sunshine Kids (No Recalls)

3104 142nd Ave S, #105, Sumner, WA 98390, 888-336-7909, www.skjp.com

## Team-Tex America

PO Box 3194 Rock Hill, South Carolina 29732, 877-912-1313

### Infant Seat

**Baby Ride Problem #1:** model 374199 made 12/18/08. Belt routing label w/ horizontal reference line is incorrectly placed on seat causing seat to be overly reclined. **Call:** 877-912-1313 for label & placement instructions. **Problem #2:** made 8/31/06-10/23/06. Belt routing label w/ horizontal reference line is incorrectly placed on seat causing seat to be overly reclined. **Call:** 877-912-1313 for label & placement instructions.

## Teutonia USA (No Recalls)

150 Oaklands Blvd, Exton, PA 19341, 877-838-8664, www.teutoniausa.com

## Triple Play Products

10275 Wayzata Blvd, Ste 280 Minnetonka, MN 55305, 800-829-1625  
www.tripleplayproducts.com

### Convertible Seats

**Sit 'n' Stroll Problem #1: Model 4002** made 5/5/08. Harness adjuster webbing fails to meet strength requirements, may cause child to be improperly restrained in a crash. **Call:** 800-829-1625 for repair kit with replacement harness adjuster strap. **Problem #2: Model 2003** made 9/1/02-10/21/03. When used w/ lower seat belt path or when shoulder & buckle pads are used, too much forward head movement. Pads may interfere w/ ability to tighten harness. Parents should remove & discard shoulder & buckle pads & use only

upper forward-facing belt path **Call:** 800-829-1625. **Problem #3: model 2240** made 4/01-10/01. Certification label printed in yellow instead of red. **Call:** 800-829-1625.

## Volvo Cars North America

Seven Volvo Drive Rockleigh, NJ 07647 www.volvocars.com

**All child seats! Problem:** Child can open buckle too easily. **Call:** Dealer to arrange for return of seat.

## XSCi (Out of Business)

**All Infant Seats** made 2/1/02-3/7/02. **Problem:** In crash, child's head moves too far forward & cradle may detach causing injury or death. Do not use! **Destroy!**



# Archive List

## Car Seat Recalls/Defects & Safety Notices Revised January 2009



This list, covering child car seats manufactured from 1/1/81 until 12/31/99, was compiled by the Safety Restraint Coalition (425) 828-8975 or 1-800-282-5587 (WA State only). National Highway Traffic Safety Administration & manufacturers do not recommended using restraints older than six to ten years. This list contains older seats as a reference document. Information may change, always call manufacturer to verify.

### Alkot (see Love Seat)

### All Our Kids (Out of business)

**Travel Vest:** All models **Problem:** Fails flammability. **Destroy!**

### American Motors

(See Love Seat)

### Babyhood (out of business)

#### Convertible Seats

**Baby-Sitter Model 8200** made 1/92-6/93. **Problem:** Buckle can be hard to release. **Destroy!**

**Wonda Chair Model 810** pre-12/82. **Problem:** Harness may be misrouted. **Destroy!**

### Basic Comfort

455 Lincoln Street, Denver, CO 80203  
800-456-8687, www.basiccomfort.com

#### Booster Seats

**Galaxy 2000 All models Problem #1:** Improperly positioned shoulder belt may increase risk of injury. **Destroy!** **Problem #2:** Made 11/25/98-1/31/99. Defective backs & cushions may become brittle. **Destroy!**

### Bobby Mac (see Evenflo)

### Bolform (out of business)

**Buckle Up Model 84E-019 Problem:** Failed crash test. **Destroy!**

### Britax

13501 S Ridge Dr  
Charlotte, NC 28273,  
888-427-4829, www.britaxusa.com

#### Convertible Seats

**Roundabout Model 161** made 1/13/99-3/14/99. **Problem:** Shell may be molded incorrectly allowing too much forward head movement. **Destroy!**

#### Forward Facing Only Seats

**Freeway model 101** made 6/1/96-4/18/97. **Problem:** Buckle can be opened by lifting up on push button. **Destroy!**

### Century (see Graco)

### Champion (see Renolux)

## Chrysler

#### Built-In Child Seats

**Minivans** Made 6/96-7/96. **Problem:** Bolts holding seat to frame can break. **Call:** dealer for replacement.

**1996-1997 Town & Country, Dodge Caravan/Grand Caravan, Plymouth Voyager/Grand Voyagers.** **Problem:** Latch plate becomes dirty making harness release difficult. **Call:** dealer to clean & add emergency release extender.

**1998 Dodge Caravan & Grand Caravan; Plymouth Voyager, Grand Voyager, & Town & Country.** **Problem:** Shoulder harness webbing may be incorrectly routed & fail in crash. **Call:** dealer for inspection/correction of threading.

### Collier Keyworth

(Out of business)

**Safe & Sound II** made 12/28/84-4/3/85. **Problem:** Buckle fails (single tongue, no writing on back). **Destroy!**

### Dorel Juvenile Group (Cosco/Maxi-Cosi/ Safety 1st/Quinny/Eddie Bauer)

2525 State Street, Columbia, IN 47201  
800-544-1108, www.djgusa.com

#### Car Beds

**Dream Ride Model 02-719 (w/ blue/ pink plaid cover)** made 1/89-1/11/94. **Problem:** Cover not flame retardant. **Destroy!**

**Dream Ride Ultra Model 02-719** made 4/94-6/95. **Problem:** Seat rotates too far forward in crash. **Destroy!**

#### Infant Seats

**Voyager (w/ stroller)** made 9/8/97-10/27/97. **Problem:** When used in stroller carrier may dislodge & fall. **Destroy!**

**Arriva Problem #1: Models begin "02-" 665, 729, 731, 732, 733, 751, 756, & 757** made 3/1/95-9/9/97. Handle releases suddenly when carried seat may flip & child may fall. **Destroy!** **Problem #2: 02-751 DDF or MMF** made 3/1/95-5/31/95. Latch release button & spring may separate when button is pushed. **Destroy!** **Problem #3: Model 02-729TED** made 3/31/99-4/7/99 **Problem:** Missing air bag warning label. **Destroy!**

**Turnabout Models begin "02-" 667, 758, 759, 760, 761, 762, 763, 764, & 765.**

made 3/1/95-9/9/97. **Problem:** Handle releases suddenly when carried seat may flip & child may fall. **Destroy!**

#### Convertible Seats

**Safe-T-Shield Models 81A, 81B, 181A, 181B (w/ metal pull knobs)** made 1/81-6/83. **Problem:** Push-pin holding shield may break making child difficult to remove. **Destroy!**

**Safe-T-Mate** Made 1984. **Problem:** Instructions show wrong rear-facing belt placement. **Destroy!**

**Safe & Easy 313; Safe & Snug 323 & Luxury Safe & Snug 423.** Made 1/84-6/85. **Problem:** Cracks appear where frame attaches to shell. **Destroy!**

**Soft Shield: Soft Shield 02-090 & Soft Shield Deluxe 02-190, Auto Trac 02-290, Luxury 02-790 & 02-890** Made 10/89-6/90. **Problem:** Child's head goes too far forward. **Destroy!**

**Deluxe Commuter Tray Shield model 02-086** Made 11/1/87-2/10/88.

**Problem:** Exposed foam is choking hazard. **Destroy!**

**Touriva 5-pt. Models 02-514, 02-584, & 02-518 Problem:** Made 8/9/97-8/22/97 w/ mold #3 on top back of shell (may need to remove locking clip on seat back to see number). OR Belt path in shell may weaken when used in forward-facing reclined position. **Destroy!**

**Touriva Overhead-Shield Models 02-014 & 02-015** Made 8/9/97-8/22/97 w/ mold #3 on top back of shell (may need to remove locking to see number). **Problem:** Belt path may weaken when used in forward-facing reclined position. **Destroy!**

#### Touriva Safe T-Shield

**Problem #1: models 02-084, 02-096, 02-404, 02-094 & 02-821.** Made 5/1/96-11/26/97. Buckle release is difficult. **Destroy!** **Problem #2: model 02-084** made 5/6/94-8/10/94. Buckle may break & harness can loosen. **Destroy!**

### Early Development

(Out of Business) (No Recalls)

### Evenflo

1801 Commerce Drive, Piqua, OH 45356,  
800-233-5921, www.evenflo.com

#### Infant Seats

**Infant Seat Problem #1: Models 456 & 458** made pre-4/10/89. Exceeds safe angle in most reclined position. Thread shoulder belt through plastic clip on

seat back. If only lap belt, use seat only in first position. **Call:** 800-233-5921.

**Problem #2: models 456 & 458** made 4/15/85-4/22/90. Black buckle seems secure when not fully latched. **Call:** 800-233-5921

**Dyn-O-Mite Problem #1: models 441, 446 & 448 w/ tubular steel frame** made pre-2/89. Exceeds safe angle in most reclined position. Thread shoulder belt through clip on seat back. If only lap belt, use only in first three positions. **Call:** 800-233-5921. **Problem #2: models 202, 441-446 & 448** made 4/15/85-4/22/90. Black buckle seems secure when not fully latched. **Call:** 800-233-5921

**SecureRide model 626** made 8/15/94-3/17/95. **Problem:** Air bag label improperly placed. **Call:** 800-233-5921

**On My Way & Travel System car seat/stroller. Problem #1: models 207 & 492** made 12/15/95-7/27/97. Handle releases unexpectedly when carried causing seat to flip & child to fall. Do not use as carrier! OR **Problem #2: model 206** made 5/7/94-5/31/95. Cracks develop on shell. OR **Problem #3: All seats w/ Position Right Bases** see #2 above. **Problem 1-3 Call:** 800-233-5921

**Joy Ride all models Problem:** When used w/ base see Travel Tandem recall below. **Problem #2: models 203, 205, 210, 435, & 493** made 1/1/88-12/31/98. Handle releases suddenly when carried causing seat to flip & unbuckled child to fall. Do not use as carrier! **Call:** 800-233-5921.

**Travel Tandem (Joy Ride w/ base)** Made 9/1/93-3/31/96. **Problem:** When tested w/ base, shell broke & seat released from base. Do not use base! **Call:** 800-233-5921.

#### Convertible Seats

**Bobby-Mac Champion 411; Bobby-Mac Deluxe 412, 414, 415** made 4/15/85-4/22/90 **Problem:** Black buckle seems secure when not fully latched. **Call:** 800-233-5921

**One Step & One Step Deluxe models 401-409 & 223** made 4/15/85-4/22/90 **Problem:** Black buckle seems secure when not fully latched. **Call:** 800-233-5921

410 made 6/88-4/89. **Problem:** Ejection of child. **Call:** 800-233-5921

**Guardian T-Shield models 634, 643, 653, 654 & 655** made 1/31/90-5/3/90 **Problem:** Buckle release too easy. **Call:** 800-233-5921

**Ultara I Problem #1: model 420** made 9/22/88-7/1/89. Buckle hard to unlatch. **Call:** 800-233-5921. **Problem #2: model 231** made 2/8/93-8/4/93. Harness sleeve makes buckling difficult. **Call:** 800-233-5921.

**Ultara II Problem #1: model 232** made 2/8/93-8/4/93. Harness sleeve makes buckling difficult. **Call:** 800-233-5921. **Problem #2: model 227** made 1/5/90-6/90. Too much forward movement. **Call:** 800-233-5921

**Champion/Trooper/Scout 5-Pt. Problem #1: model 229** made 6/1/93-12/16/96. Increased risk of injury in

crash. Call: 800-233-5921 use reclined position only. **Problem #2:** Made 10/14/96-2/6/97. Too much forward movement. Call: 800-233-5921.

**Champion/Trooper/Scout T-Shield model 225** made 10/14/96-2/6/97. **Problem:** Too much forward movement. Call: 800-233-5921

**Champion/Trooper/Scout Tray Shield model 224.** **Problem #1:** made 2/8/93-8/4/93. Harness sleeve makes buckling difficult. OR **Problem #2:** made 6/1/93-11/22/96. Increased risk of chest injury. Use only in reclined position. OR **Problem #3:** made 10/14/96-2/6/97. Too much forward movement increases risk of head injury. **Problems 1-3 Call:** 800-233-5921.

**Champion/Trooper/Scout Adjust-A-Shield model 219.** **Problem #1:** made 11/27/95-1/22/96. Toddler section of instructions labeled for Infant use, causing user to believe Infants under 20 lbs. can ride forward-facing. Call: 800-233-5921. **Problem #2:** made 10/14/96-2/6/97. Too much forward movement. Call: 800-233-5921.

### Combination Seats

**Seven Year Problem #1:** models 453 & 454 made 2/13/87-10/31/88. Pins present choking hazard. Call: 800-233-5921. **Problem #2:** models 453, 454, & 228 made 4/15/85-4/22/90. Black buckle seems secure when not fully latched. Call: 800-233-5921.

**Two-in-One models 636 & 637** made 1/7/98-3/20/98. **Problem:** Back & seat base separate when used w/ harness. Call: 800-233-5921.

### Booster Seats

**Small Shield Problem #1:** models 470 & 471 made 2/13/87-10/31/88. Pins on pad present choking hazard. Call: 800-233-5921. **Problem #2:** models 471, 242 made 4/15/85-4/22/90. Black buckle seems secure when not fully latched. Call: 800-233-5921.

**Sidekick model 244** made 4/23/96-5/20/97. **Problem:** Shield allows too much forward movement increasing risk of injury. Call: 800-233-5921

### F.B.S. (See Renolux)

### Fisher Price

(No longer makes Car Seats)  
636 Girard Ave, East Aroua, NY 14052  
800-432-5437 www.fisher-price.com

### Infant Seats

**Model 9149** made 1/1/91-2/27/91. **Problem:** Shield can separate. **Destroy!**  
**Model 9173** made 9/1/94-10/31/94. **Problem:** Air bag warning label can not be seen when in front seat. **Destroy!**

### Convertible Seats

**Safe Embrace model 79700** made 5/19/97-3/29/98. **Problem:** Harness adjuster spring can break/dislodge. If it fails, harness may not lock. **Destroy!**

**Models 9100 & 9101 T-Shield** **Problem #1:** Affects model 9100 only made 4/85-8/85. Shield may break during use; OR **Problem #2:** made pre-1987. Strap may be missing button

to keep straps from retracting too far; OR **Problem #3:** made 1/1/85-9/1/90. Button may be missing/work loose & present choking hazard; OR **Problem #4:** made 5/1/87-10/31/89. Shield may be hard to latch due to internal cracks. OR **Problem #5:** made 1985-1/26/89. White foam pad between pad & shell failed flammability tests. OR **Problem #6:** made pre-7/89. Metallic label glued to shield comes loose creating choking hazard. OR **Problem #7:** made 2/5/90-3/24/90. Possible structural weakness in metal tongue. OR **Problem #8:** made 2/8/91-1/24/92. Harness straps come unfastened at seat back. **Problems 1-8: Destroy!**

**Deluxe Tray Shield Model 9104** made 6/15/92-9/4/92. **Problem:** Red button on buckle pops up preventing latching. **Destroy!**

### Ford (see Love Seat)

### Freedom Ride

(Out of Business) (No Recalls)

### General Motors

#### Built-In Child Seats

**Chevrolet Oldsmobile & Pontiac vans w/ power sliding doors** made 11/92-7/93 & 9/93-3/94. **Problem:** Needs new trim panel so belt doesn't catch in door. Call: dealer.

**Chevrolet & GMC ML model vans** made 5/96-9/97. **Problem:** Harness may be missing hidden piece & will not lock! Call: dealer for inspection & replacement.

### Gerry (see Evenflo)

### Graco

150 Oaklands Blvd Exton, PA 19341  
800-345-4109, www.gracobaby.com

#### Infant Seats

**Century Infant Seats & 4-in-1 Systems w/ straight handles** (W-shaped handles not affected). Seats made 1/01/91-7/31/97. **Problem:** Handle releases unexpectedly when carried causing seat to flip & unbuckled child to fall. **Destroy!**

**All Century Infant Seats & 4-in-1 Systems. All models beginning "45" or "11"** made 9/12/95-5/13/96 (091295-051396) & having date code 255-95 through 365-95 or 001-96 through 131-96 on buckle top (above red push button on either side of the word "Infant") are affected. **Destroy!**

**580 Problem #1:** models 4580, 4581, 4583, 4585 made pre-12/31/89 (8912 & lower). When adjusting or relocating straps, parents may improperly rethread through metal retention slides. In sudden stop/crash, straps will not restrain child. **Destroy!** **Problem #2:** models 4581, 4583, & 4585 made pre-11/89 (8910 & lower). Retaining screws on handle may loosen & separate from seat. **Destroy!**

#### Convertible Seats

**Model 4100 & 4200 Problem #1:**

made 4/85-2/86 (8504-8602) w/ "mold #1" engraved above top bar. Plastic too thin under child's bottom. OR **Problem #2:** made 1/81-4/81 (8101-8104). Buttons on pad loosen & present choking hazard. OR **Problem #3:** made 1/1/81-1/1/83 (8101-8212). Buckle release is difficult. OR **Problem #4:** model 4200 made 6/81 has wrong washers. **Problems 1-4: Destroy!**

**Model 4300** made 4/85-2/86 (8504-8602) w/ "mold #1" engraved above top bar. **Problem:** Plastic too thin under child's bottom. **Destroy!**

**Model 4400XL** **Problem #1:** Made 4/85-2/86 (8504-8602) w/ "mold #1" engraved above top bar. Plastic too thin under child's bottom. **Destroy!** **Problem #2:** Made pre-5/86, (8604 & lower). New label needed to tell if restraint is properly locked. **Destroy!**

**Models 1000, 2000, 3000 & 5000 STE** made 12/90-10/91 (9012-9110). **Problem:** Spanish labels have "bebes" & "ninos" transposed at belt path. **Destroy!**

**Smart Move Tray Shield model 4750** made 12/5/95-2/13/96 (120595-021396). Affected seats, have number: WO#138442-01, WO#136716-01, -02, or -03 on white label sewn to harness near splitter plate. **Problem:** Latch can release when seat is forward-facing & harness in slot closest to crotch. **Destroy!**

**2000 STE T-Shield Problem #1:** made pre-6/89, (8906 & lower). Shoulder straps may be glued (not sewn). Check loops at splitter plate on seat back. **Destroy!** **Problem #2:** models 4253, 4261, 4263, 4265 & 4266 made 12/91-4/30/92, (9112-9204). Push button can fail allowing shield/harness to release. **Destroy!**

**3000 STE Tray-Shield Problem #1:** Fabric on shield has Velcro, child may unfasten Velcro & pull apart foam. OR **Problem #2:** models 4365 & 4368 made 5/7/90-6/14/90 (9005-9006). Latch tongue breaks in crash allowing child to slip out. OR **Problem #3:** models 4353, 4365, & 4368 pre-1/1/91 (9101 & lower). Instructions may not advise when to switch from rear to forward latching positions. Failure to switch to forward latching position for a child more than 30 lbs. makes release difficult after crash. OR **Problem #4:** made 9/89-4/92 (8909-9204) release button rotates up in crash making release difficult. **Note:** Some seats were repaired with defective button. **Problems 1-4: Destroy!**

**3500 STE Tray-Shield** made 9/89-4/92 (8909-9204). **Problem:** Release button rotates up in crash making release difficult. **Note:** Some seats were repaired with defective button. **Destroy!**

**5000 STE Tray-Shield Problem #1:** models 4450, 4460, 4470, & 4475 pre-1/1/91 (9101 & lower). Instructions may not advise when to switch from rear to forward latching positions. Failure to switch to forward latching position for child more than 30 lbs. makes release difficult after crash. OR **Problem #2:** Seats made 9/89-4/92 (8909-9204). Release button rotates up in crash making release difficult. **Note:** some seats were repaired with defective button. OR

**Problem #3:** models 4470 & 4475 made 5/90-6/90 (9005-9006). Latch tongue breaks in crash allowing injury. **Problems 1-3: Destroy!**

**5500 STE** made 9/89-4/92 (8909-9204). **Problem:** Release button rotates up in crash making release difficult. **Note:** some seats were repaired with defective button. **Destroy!**

### Booster Seats

**Breverra Premiere & Breverra Contour all models w/ harness** made 2/1/95-7/10/98. **Problem:** Buckle can crack or break. **Destroy!**

### International (Out of Business)

**Astroseat** made pre-8/81. **Problem:** Buckle pulls through webbing. **Destroy!**

### Kantwet (see Evenflo)

### Kolcraft (No longer makes car seats)

1100 W Monroe Street, Chicago, IL 60607, 800-453-7673, www.kolcraft.com

#### Infant Seats

**Rock 'N Ride model 13123 Problem #1:** made 1/85-6/85. Plastic may crack in crash. **Destroy!** **Problem #2:** made pre-4/90. Plastic clips attaching pad present choking hazard. **Destroy!**

**Infant Rider, Travel-About, Plus 4, Plus 5, & Carters Travel 5.** Look for 5-digit model # beginning 131xx, 138xx, or 368xx made 3/4/96-9/30/96. **Destroy!**

**Infant Restraint, Infant Car Seat, Infant Rider, Secura, Travel-About, Plus 4, Plus 5, & Playskool (some w/ strollers) models 1312x, 1382x, 1383x, 1384x, 1385x, 368xx, 43xxx, & 7700x** made 1/1/93-6/30/99. **Problem:** Handle moves unexpectedly causing seat to rotate; allowing unbuckled child to fall. **Destroy!**

#### Convertible Seats

**Dial-A-Fit Problem #1:** made 10/1/88-8/16/89. Too much forward head movement in crash. OR **Problem #2:** made pre-4/90. Buttons attaching pad break & present choking hazard. **Problems 1-2: Destroy!**

**Dial-A-Fit II model 180-600** made 11/1/90-6/30/91. **Problem:** In rear-facing tests shell cracked. **Destroy!**

**Perfect Fitt Problem #1:** model 180-200 made pre-10/90. Failed flammability test. OR **Problem #2:** models 180-150 & 180-200 made 3/1/89-10/1/90. Too much forward movement in crash increases risk of injury. OR **Problem #3:** made pre-4/1/90. White pad clips break presenting choking hazard. **Problems 1-3: Destroy!**

**Traveler 700 Problem #1:** made after 11/1/94. Buckle performance questionable. OR **Problem #2:** model 150-100, Style 13400 & 13401 made 1/1/91-8/7/91. Shield may break. OR **Problem #3:** Dates unknown. Labels have incorrect drawings. OR **Problem #4:** made 1/24/91-6/30/93. Crotch buckle rusts. **Problems 1-4: Destroy!**

**Automate T-Shield Problem #1:** model 180-600 & 180-601 made 1/30/92-3/22/93. Crotch buckle rusts. **Destroy!**

**Performa Tray-Shield Problem #1:** made 3/96-5/31/96. Flammable cover. **Destroy!** **Problem #2:** made 1/26/96-7/31/97. Buckle release difficult after crash. **Destroy!**

**Secure-Fit** made 1/26/96-7/31/97. **Problem:** Buckle release difficult after crash. **Destroy!**

**Playskool Problem #1:** models 140-155 & 180-400 made 12/89-8/90. Flammable foam pad. **Destroy!** **Problem #2:** models 77001 & 77002 w/ comfort pump made 1/1/91-6/30/93. Label missing & crotch buckle rusts. **Destroy!**

#### Booster Seats

##### **Flip 'N Go**

**Problem #1:** model 191-100 & 191-200 style 19127 made pre-3/19/87. Defect in shape of shield. **Destroy!**

##### **Lin Lih**

##### **Counterfeit Seat**

**Problem:** Import seat failed government crash test! If you see this seat for sale, or have purchased one, DO NOT USE! **Call:** 800-424-9393.

##### **Little Cargo**

(Out of Business) (No Recalls)

##### **Love Seats** (Out of Business)

#### Infant Seats

**Models 4477B1-4477M1 & 4477A2-4477F2.** Made 1/81-7/82. **Problem:** Defective plastic. **Destroy!**

#### Forward Facing Only Seats

**All non-adjustable Toddler seats** made 3/84-11/20/84, Lot 4477C4 (stamped on rear). **Problem:** Defective plastic. **Destroy!**

##### **Mercedes Benz USA**

(Child Seats manufactured by Britax)

#### Infant Seats

##### **Infant Seats & Boosters**

made 2/97-7/99. **Problem:** Baby Smart air bag deactivation device fails to turn off passenger air bag. **Call:** Dealer for replacement.

#### Booster Seats

**Booster Seats** made 2/97-7/99. **Problem:** Baby Smart air bag deactivation device fails to turn off passenger air bag. **Call:** Dealer for replacement.

##### **Playschool** (see Kolcraft)

##### **Porsche**

(Child Seats made by Britax)

**Porsche Child Seat for '97-'98 Boxters, 911 Carrera, Carrera S, 911 Carrera 4, 4S & 911 Turbo.**

**Problem:** Air bag deactivation may not work. Air bag may deploy. **Call:** Dealer, do not use until repaired.

##### **Pride Trimble** (see Evenflo)

#### Convertible Seats

**Model 832,** made 1/88-4/89. **Problem:** Using optional armrest, head moves too far forward in crash. **Destroy!**

#### Booster Seats

**Click 'n Go model 890, 891 & 892** made 2/86-10/87. **Problem:** Failed testing. **Destroy!**

##### **Questor** (See Evenflo)

##### **Renolux** (Out of Business)

#### Convertible Seats

**GT-1000 #69985,** made 1/85-1/86. **Problem:** Rear-facing failed test. **Destroy!**

**GT-2000 Problem #1:** made 1/1/92-1/31/93, foam compresses too much. **OR Problem #2:** made 5/89-6/9/93, failed flammability test. **OR Problem #3:** made 8/15/88-10/31/88 (also labeled Champion Children's Products GT-1000 or F.B.S. model 200). Buckle releases too easily & seat is too reclined when rear-facing. **Problems 1-3: Destroy!**

**GT-4000 Problem #1:** made 1/1/92-1/31/93, foam compresses too much in crash. **Destroy!** **Problem #2:** made 5/89-6/9/93 fail flammability test. **Destroy!**

#### **GT-5000 or model 500 Turn-A-Tot**

**Problem #1:** made 2/18/90-4/29/91 base allows too much forward movement in crash; failed flammability test. **OR Problem #2:** made 1/1/92-1/31/93, foam compresses absorbing crash impact; base allows too much forward movement in crash; failed flammability test. **OR Problem #3:** made 5/89-6/9/93 failed flammability test. **Problems 1-3: Destroy!**

**GT-5500 Problem #1:** made 1/1/92-1/31/93, foam compresses too much in crash. **Destroy!** **Problem #2:** made 5/89-6/9/93, fail flammability test. **Destroy!**

**GT-7000 all models. Problem #1:** made 1/1/92-1/31/93 foam compresses too much in crash. **OR Problem #2:** Remote attachment can overheat & smoke increasing risk of fire. **OR Problem #3:** made 5/89-6/9/93, fail flammability test. **Problems 1-3: Destroy!**

##### **Strolee** (Out of Business)

#### Convertible Seats

##### **Wee Care 599**

made 12/15/80-5/29/81. **Problem:** Clips on armrest present choking hazard. **Destroy!**

**Models 609 & 610 Problem:** Plastic may crack. **Destroy!**

**GT-3000** made 1987-88. **Problem:** Seat failed crash test rear-facing. **Destroy!**

#### Booster Seats

**Quick-Click 605** w/ 4/85 stamped on seat bottom. **Problem:** Failed crash test. **Destroy!**

##### **Triple Play Products**

904 Main St, Ste. 330, Hopkins, MN, 55343, 800-829-1625

www.tripleplayproducts.com

#### Convertible Seats

**Sit 'n' Stroll Problem: model 3240** made 6/9/97-8/9/97. Missing air bag warning label. **OR Problem #2: model 3240** made 11/1/96-6/30/99. Incorrect rear-facing weight limit on label. Use seat rear-facing only up to 22 lbs. **OR Problem #3: model 3240** made 11/1/96-6/30/99. Incorrect rear-facing weight limit on label. Use seat rear-facing only up to 22 lbs. **Problems 1-3 Call:** 800-829-1625.

##### **T.R.W.** (See Love Seat)

##### **Virco** (See Pride Trimble)

